

STANDARD NOTICE OF WORK COMPLETED AND NOT COMPLETED

NOTICE - All recommendations may not have been completed. - See below - Recommendations not completed.
This form is prescribed by the Structural Pest Control Board.

Building No. 668	Street, City, State, Zip WASHINGTON AVENUE (W) , SUNNYVALE CA 94086	Date of Completion 11/14/2017
<p>ANTIQUE TERMITE, INC. 1913 Stone Avenue, San Jose, CA 95125 Ph: (408) 995-6300 (408) 995-0517 Fax</p>		
Firm Registration No. PR 1187	Report No. 56816	Escrow No.
Ordered By: BRIJESH AND KATHLEEN D'SILVA 668 WASHINGTON AVENUE W SUNNYVALE, CA 94086	Property Owner/Party of Interest BRIJESH AND KATHLEEN D'SILVA 668 WASHINGTON AVENUE W SUNNYVALE, CA 94086	Report Sent To:

The following recommendations on the above designated property, as outlined in Wood Destroying Pests and Organisms Inspection Report dated 11/15/2017 have been and/or have not been completed.

Recommendations completed by this firm that are in accordance with the Structural Pest Control Board's Rules and Regulations:
1A, 1C

Recommendations completed by this firm that are considered secondary and substandard measures under Section 1992 of the Structural Pest Control Board's Rules and Regulations including Person requesting secondary measure:
None Noted

Cost of work completed:	Cost: \$	<u>520.00</u>
	Inspection Fee: \$	<u>0.00</u>
	Other: \$	<u>0.00</u>
	Total: \$	<u>520.00</u>

Recommendations not completed by this firm:
1B

Estimated Cost: \$ _____

Remarks:
Chemical used: Timbor

RECEIVED & READ

SIGNATURE DATE

SIGNATURE DATE


You are entitled to obtain copies of all reports and completion notices on this property reported to Board during the preceeding two years upon payment of a search fee to: The Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815-3831.
NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708 or (800) 737-8188 or www.pestboard.ca.gov.

Lot 6

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

BUILDING NO. 668	STREET, CITY, STATE, ZIP WASHINGTON AVENUE (W), SUNNYVALE CA 94086	Date of Inspection 11/15/2017	No. of Pages 5
ANTIQUE TERMITE, INC. 1913 Stone Avenue, San Jose, CA 95125 Ph: (408) 995-6300 (408) 995-0517 Fax			
Firm Registration No. PR 1187	Report No. 56816	Escrow No.	
Ordered By: BRIJESH AND KATHLEEN D'SILVA 668 WASHINGTON AVENUE W SUNNYVALE, CA 94086	Property Owner/Party of Interest BRIJESH AND KATHLEEN D'SILVA 668 WASHINGTON AVENUE W SUNNYVALE, CA 94086	Report Sent To:	
COMPLETE REPORT <input type="checkbox"/> LIMITED REPORT <input checked="" type="checkbox"/> SUPPLEMENTAL REPORT <input type="checkbox"/> REINSPECTION REPORT <input type="checkbox"/>			
General Description: LIMITED TO THE SUBAREA ONLY		Inspection Tag Posted: GARAGE	
		Other Tags Posted:	
An inspection has been made to the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.			
Subterranean Termites <input type="checkbox"/> Drywood Termites <input type="checkbox"/> Fungus/Dryrot <input checked="" type="checkbox"/> Other Findings <input checked="" type="checkbox"/> Further Inspection <input type="checkbox"/>			
If any of above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.			

DIAGRAM NOT TO SCALE

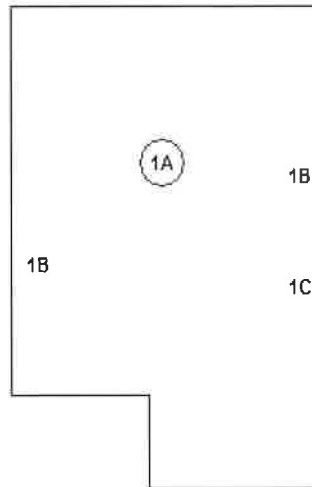

Inspected by LUIS E. RODRIGUEZ State License No. FR38503 Signature

[Handwritten Signature]

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control board at (916) 561-8708, or (800) 737-8188 or www.pestboard.ca.gov.

[Handwritten Date: 2017]

668

WASHINGTON AVENUE (W), SUNNYVALE CA 94086

11/15/2017

56816

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

AREAS NOT INSPECTED: The interior of hollow walls, areas beneath and behind built in cabinets were not inspected since inspection of these areas are considered impractical. We did not water test and do not certify against leakage of any appliances, plumbing over finished ceilings, roof coverings or decks. Such actions, were not performed, they are considered impractical without specific written authorization. Floors which are carpeted makes inspection of the flooring in these areas impractical. Soffitted (enclosed framing) areas of the structure, makes inspection of interior framing inaccessible for inspection. We make no guarantee against infestations, leaks or adverse conditions which may exist in such areas not inspected. Attached and/or detached fences were not inspected unless otherwise stated in the body of this report. Further inspection is recommended. Further inspection of any inaccessible area and/or area not inspected would be performed upon request at an additional charge (with written authorization). This property was not inspected for the presence or absence of health related molds or fungi. By California Law we are neither qualified, authorized, nor licensed to inspect for health related molds or fungi. If you desire information about the presence or absence of health related molds, you should contact an industrial hygienist.

No furniture or appliances were moved or removed, limiting this inspection to the visible and accessible areas of the above structure shown on the diagram. No statements can be made regarding conditions in closed walls, floors beneath coverings, areas below or behind appliances and built-in cabinet work, stall showers over finished ceilings, such structural segments as porte cocheres, enclosed bay windows, buttresses and similar areas to which there is no access without defacing or tearing out lumber, masonry or finished work. The exterior surface of the roof was not inspected. If interested parties want water tightness of the roof determined, they should contact a roofing contractor who is licensed by the Contractor's State License Board. Antique Termite assumes no responsibility for leaks not evident during the time of this inspections. Our inspectors are not equipped with extension ladders, therefore all buildings will be inspected from the ground level only. All wood members above 10 from the ground level would be visually inspected only (no probing, etc). Further inspection of these inaccessible area(s) or area(s) not inspected is recommended and will be performed upon request and at an additional fee.

REINSPECTIONS: If requested by the person ordering this report, a reinspection of the structure will be performed. This company will reinspect repairs done by others within four (4) months of the date of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs. Antique Termite Inc. does not guarantee work performed by others. Reinspection fee is payable at the time of inspection.

GUARANTEES: On work (labor) performed by Antique Termite Inc. are for one (1) year from the date of completion. Guarantees for local chemical treatments are limited to wood members treated only. Fumigations are guaranteed for three years from the date of completion. Plumbing repairs (parts provided by this firm), linoleum (vinyl materials), toilet resets or any other measures for the control of moisture (caulkings and grouts etc.) are guaranteed for thirty (30) days. Antique Termite, Inc. assumes no responsibility for water damage if the shower enclosure is not installed immediately. The guarantee on showers and tub units is void if the area is used before 24 hours. If the shower fixtures do not fit the owner must contact other tradesman to have new fixtures installed. If necessary for floor installation, vanities are to be removed and replaced by others. Kitchens and laundry areas also must have appliances removed before installation. An additional fee of \$ 75.00 per appliance and or furniture will be charged for Antique Termite to remove and/or reinstall. We do not do painting, texturing, staining or wallpapering.

Notice: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.) However, recommendation to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

668	WASHINGTON AVENUE (W), SUNNYVALE CA 94086	11/15/2017	56816
BUILDING NO.	STREET, CITY, STATE, ZIP	INSPECTION DATE	REPORT NO.

WHILE PERFORMING TREATMENTS OR ANY CONSTRUCTION REPAIRS, ANTIQUE TERMITE INC. WILL NOT BE RESPONSIBLE OR LIABLE FOR ANY DAMAGE TO ELECTRICAL OR PLUMBING WHICH MAY BE CONCEALED IN WALLS OR BELOW SLABS. BUILDING PERMITS REGARDING REPAIRS WHICH A BUILDING PERMIT IS REQUIRED, IF IT IS FOUND THAT LOCAL BUILDING CODES REQUIRE ADDITIONAL REPAIRS TO BE PERFORMED, THESE ADDITIONAL REPAIRS WOULD BE AT THE OWNERS EXPENSE AND SAME WOULD BE OUTLINED A SUPPLEMENTAL REPORT.

TILE OR LINOLEUM SELECTIONS: Bids which are given in report for replacement of ceramic tile or linoleum are based on using standard grade material. Ceramic tile bids are based on standard-square 4 tiles at a cost of \$2.78 per square foot for shower walls or tub shower walls. Ceramic floor tile bids are based on 8x8 tiles at \$2.75 per square foot. Tile selections can be made at Dal Tile 2549 Zanker Road San Jose CA 95131 408-435-1566. Linoleum bids are based on using standard grade linoleum at \$.99 per square foot. Linoleum selections can be made at S&G Carpet 4952 Almaden Expressway, San Jose, CA 95118 (408) 414-1188 Tile and/or linoleum selections must be made at least 5 days prior to scheduled repairs. Any upgrades, must be paid by client at the time of selection. If NO selection is made prior to repairs, standard/neutral color tile or sheet vinyl will be installed.

MOLD POLICY STATEMENT: Molds, sometimes called mildew, are not wood destroying organisms. Branch 3 licensees do not have a duty under the Structural Pest Control Act and related regulations to classify molds as harmful to human health or not harmful to human health. This does not modify the Structural Pest Control Act or related regulations.

SECONDARY RECOMMENDATION (SUB STANDARD): Anytime a secondary recommendation (local treatment) is recommended, we must state who requested this secondary recommendation. Secondary recommendations are considered sub standard recommendations and guarantees are limited to treated areas only as stated in report.

Addendum to Contract: Due to recent changes in the law, we are required to give you the following notice. If our inspection report contains a recommendation for lethal gas fumigation. This company subcontracts lethal gas fumigation to : Cost Less Fumigation Inc. (408) 918-9100 or Driskell Fumigation (408) 920-6353 .

Notice: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept Antique Termite Inc's bid or you may contract directly with another registered company. Antique Termite Inc. will not be responsible for any act or omission in the performance of work that you directly contract with another to perform. By signing the attached contract, you authorize Antique Termite Inc. to subcontract this fumigation to a registered fumigation company.

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I, SECTION II AND UNKNOWN FURTHER INSPECTIONS CONDITIONS EVIDENT ON THE DATE OF INSPECTION.

SECTION I: Contains items where there is evidence of active infestations, infections, or conditions which have resulted in or from infestations or infection.

SECTION II: Are conditions deemed likely to lead to infestation or infection, but where there is no visible evidence of such found.

UNKNOWN FURTHER INSPECTION: Recommendations to inspect areas which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

668	WASHINGTON AVENUE (W), SUNNYVALE CA 94086	11/15/2017	56816
BUILDING NO.	STREET, CITY, STATE, ZIP	INSPECTION DATE	REPORT NO.

SUB STRUCTURE AREA:

- ITEM 1A FINDING: Earth contact was noted at the cellulose debris (wood scraps, cardboard, ect.) in the crawl space.

RECOMMENDATION: Remove and dispose of all cellulose debris of a rakeable size or larger.
 ***** This is a Section 2 Item ***** \$ 210.00
- ITEM 1B FINDING: Minor vertical cracks were noted at the foundation. These cracks could lead to moisture intrusion and/or infestation by subterranean termites.

RECOMMENDATION: Engage the services of the appropriate, licensed tradesperson to check this condition and make any necessary recommendations and repairs.
 ***** This is a Section 2 Item ***** OTHERS
- ITEM 1C FINDING: Surface fungus infections were noted at the hall bathroom subflooring in the area indicated on the diagram.

RECOMMENDATION: Scrape and/or wire brush all surface infected wood members and treat with a registered fungicide. Chemical to be used: Tim-bor active ingredient: Disodium Octaborate Tetrahydrate.
 ***** This is a Section 1 Item ***** \$ 310.00

During the course of repairs as outlined in this report, IF damage and/ or infestation is found to extend into previously inaccessible areas, a supplemental report will be issued outlining findings and costs for any additional repairs or treatments. Antique Termite Inc. does not do any texturing, painting or wall papering.

All repairs completed by others must be reinspected by Antique Termite before certification will be issued. The reinspection will only CERTIFY the absence of infestation or infection in the visible and accessible areas. Antique Termite does not guarantee work completed by others, nor does this firm make any statements concerning workmanship of those repairs. Workmanship is only determinable by those paying for or receiving those services. A reinspection of specific items on the report or of any other condition pertaining to this structure can be done at an additional cost of \$150.00 per trip. This reinspection must be performed within four (4) months of the Original Inspection Report. REINSPECTION FEE OF \$150.00 IS PAYABLE AT THE TIME OF INSPECTION.

"This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs."

Antique Termite, Inc. does not guarantee work performed by others. Such guarantees should be obtained from those performing the repairs. Antique Termite, Inc. only certifies the absence of infestation or infection in the visible and accessible areas. If it is found that others have concealed or hidden infestations or infections during the course of their repairs, it will be the responsibility of interested parties to pursue the responsible party. Antique Termite, Inc. does not inspect for or comment on workman like manor on repairs done by others. Interested parties must satisfy themselves with the proper permits and licenses and to the quality or appearance of work which is not completed by our company.

668

WASHINGTON AVENUE (W), SUNNYVALE CA 94086

11/15/2017

56816

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

THIS IS A LIMITED INSPECTION AT THE REQUEST OF DAVE CLARK, AND IT IS LIMITED TO THE SUBAREA ONLY. A COMPLETE INSPECTION OF THE ENTIRE STRUCTURE WAS NOT PERFORMED AT THIS TIME AS IT WAS NOT REQUESTED. A COMPLETE INSPECTION OF ENTIRE STRUCTURE IS RECOMMENDED AND WILL BE PERFORMED UPON REQUEST AT AN ADDITIONAL FEE.

CHEMICAL NOTE: Section 8538. (a): "State law requires that you be given the following information: CAUTION--PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized."

"If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800-876-4766) and your pest control operator immediately." (This statement shall be modified to include any other symptoms of overexposure which are not typical of influenza.)

FUMIGATION NOTE: "If within 24 hours you experience symptoms of dizziness, headache, nausea, reduced awareness, slowed movement, garbled speech or difficulty in breathing, leave the structure immediately and seek medical attention by contacting your physician or Poison Control Center (800-876-4766) and notify your pest control company. The warning agent, chloropicrin, can cause symptoms of tearing, respiratory distress and vomiting. Entry into the space during fumigation can be fatal"

For further information, contact any of the following:

Antique Termite Inc. (408) 995-6300, for health questions--County Health Dept (408) 918-3400, for application questions--Cnty Agriculture Commissioner (408) 918-4600, and for regulatory information--Structural Pest Control Board (916) 561-8700 located at 2005 Evergreen Street Ste #1500, Sacramento, CA 95825. The following list of chemicals may be used by Antique Termite Inc. in the treatment of the above mentioned property

<u>Chemical:</u>	<u>Manufacturer:</u>	<u>Active Ingredients:</u>
Premise Foam	Bayer Corporation	Imidacloprid
Termidor SC	BASF	Fipronil:Pyrazole
Power Plant	Blizzard System	D-Limonene
Cy-Kick	Whitmire Micro-Gen	Cyfluthrin
Vikane	Dow AgroSciences	Sulfuryl Flouride
Tim-Bor	US Borax & Chemical Corp.	Disodium Octaborate Corp.Tetrahydrate
Sodium Borate		
Termidor Dry	BASF	Fipronil:Pyrazole
Termidor Foam	BASF	Fipronil:Pyrazole
Altriset	Syngenta	Chlorantranilprole